

ELCOTEL INC.



Product Bulletin

June 5, 1990
#0005

Series 5 Modification for Slow Dial Tone and Battery Discharge

In some instances, Series 5 customers have reported that they are slow in receiving off-hook dial tone and are experiencing unusually quick battery discharge. The cause has been traced to the fact that these particular units contain early version Series 5 main boards (REV.A board) and do not include a certain modification that addresses this condition.

Customers experiencing these conditions can check for the presence of the modification; simply examine U1 on the main board for a capacitor between pins 4 and 5. This capacitor can either be on top or beneath the board.

If you *are* having dial tone/ battery discharge problems, and do *not* have the modification described above, contact Elcotel's Customer Service Department for Return Authorization; the modification will be added at no charge.